


XBA-TRY6

XBA Option Switch Settings(Pulse/MDB/ICT104U/ICT104V)

Supported bill TRY 5, 10, 20, 50, 100, 200 6bills.

FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
Reject Lira 5	ON							
★ Accept Lira 5	OFF							
Reject Lira 10		ON						
★ Accept Lira 10		OFF						
Reject Lira 20			ON					
★ Accept Lira 20			OFF					
★ Reject Lira 50				ON				
Accept Lira 50				OFF				
Reject Lira 100 & 200					ON			
★ Accept Lira 100 & 200					OFF			
Disable Bill Reject 4 Times BA Stop By 30 Sec						ON		
★ Enable Bill Reject 4 Times BA Stop By 30 Sec						OFF		
Stack Banknote when Power-up							ON	
★ Reject Banknote when Power-up							OFF	
Reserved								ON
★ Reserved								OFF

This dip switch is located at the side of XBA.

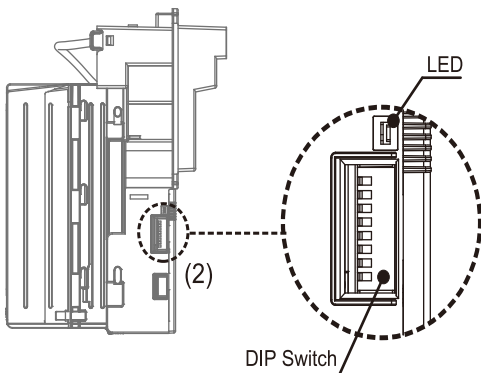


Currency Assign Data

Interface Bill value	ICT104U	ICT104V	Pulse	MDB
BV1	Lira 5	Lira 5	Lira 5	Lira 5
BV2	Lira 10	Lira 10	Lira 10	Lira 10
BV3	Lira 20	Lira 20	Lira 20	Lira 20
BV4	Lira 50	Lira 50	Lira 50	Lira 50
BV5	Lira 100	Lira 100	Lira 100	Lira 100
BV6	Lira 200	Lira 200	Lira 200	Lira 200

XBA-TRY6 (Pulse/MDB/ICT104U/ICT104V)

FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8	
Inhibit Active HIGH	ON								
★ Inhibit Active LOW	OFF								
Reserved		ON							
★ Reserved		OFF							
Reserved			ON						
★ Reserved			OFF						
Reserved				ON					
★ Reserved				OFF					
Pulse Mode	MDB Mode		ICT104V Mode						
★ Credit-Pulse Normal HIGH	Scaling Factor (SF) = 100 Decimal Point Position (DPP) = 2		Connect with coin changer			ON			
Credit-Pulse Normal LOW	Scaling Factor (SF) = 1 Decimal Point Position (DPP) = 0		Connect with ICT JPSTD converter board			OFF			
★ Pulse Mode							ON		
Other Mode							OFF		
Pulse Mode	Other Mode								
★ 1 pulse / Lira 5	MDB Mode							OFF	OFF
5 pulses / Lira 5	Reserved							OFF	ON
10 pulses / Lira 5	ICT104U Mode							ON	OFF
25 pulses / Lira 5	ICT104V Mode							ON	ON

This dip switch is located on the CPU board, remove the CPU board cover first.

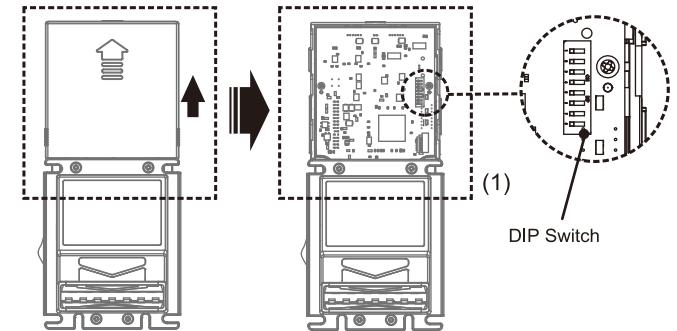

★ Manufacture setting

After setting dip switch of the credit pulses, you should reset the bill acceptor again.

Note : 1.Please reset the bill acceptor after set the dip switch.

2.Calibration card is needed.