


XBA-KZT5

XBA Option Switch Settings(Pulse/MDB/ICT104U/GPT/ICT104V)

Supported bill KZT 200, 500, 1000, 2000, 5000 5bills.

	FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
★	Reject KZT 200	ON							
★	Accept KZT 200	OFF							
★	Reject KZT 500		ON						
★	Accept KZT 500		OFF						
★	Reject KZT 1000			ON					
★	Accept KZT 1000			OFF					
★	Reject KZT 2000				ON				
★	Accept KZT 2000				OFF				
★	Reject KZT 5000					ON			
★	Accept KZT 5000					OFF			
★	Disable Bill Reject 4 Times BA Stop By 30 Sec						ON		
★	Enable Bill Reject 4 Times BA Stop By 30 Sec						OFF		
★	Stack Banknote when Power-up							ON	
★	Reject Banknote when Power-up							OFF	
★	Reserved								ON
★	Reserved								OFF

This dip switch is located at the side of XBA.

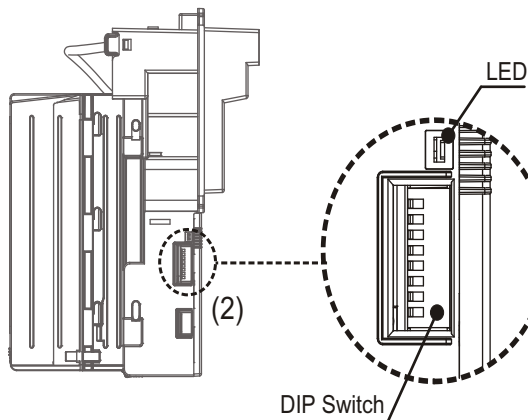


Currency Assign Data

Interface	ICT104U	GPT	ICT104V	Pulse	MDB
BV1	KZT 200	KZT 200	KZT 200	KZT 200	KZT 200
BV2	KZT 500	KZT 500	KZT 500	KZT 500	KZT 500
BV3	KZT 1000	KZT 1000	KZT 1000	KZT 1000	KZT 1000
BV4	KZT 2000	KZT 2000	KZT 2000	KZT 2000	KZT 2000
BV5	KZT 5000		KZT 5000	KZT 5000	KZT 5000

XBA-KZT5 (Pulse/MDB/ICT104U/GPT/ICT104V)

	FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8	
★	Inhibit Active HIGH	ON								
	Inhibit Active LOW	OFF								
★	Reserved									ON
	Reserved									OFF
★	Reserved			ON						
	Reserved			OFF						
★	Reserved									ON
	Reserved									OFF
★	Pulse Mode	MDB Mode			ICT104V Mode					
	Credit-Pulse Normal HIGH	Scaling Factor (SF) = 0.01 Decimal Point Position (DPP) = 0			Connect with coin changer	ON				
	Credit-Pulse Normal LOW	Scaling Factor (SF) = 1 Decimal Point Position (DPP) = 0			Connect with ICT VCCS converter board	OFF				
★	Pulse Mode						ON			
	Other Mode						OFF			
★	Pulse Mode	Other Mode								
	1 pulse / KZT 100	MDB Mode							OFF	OFF
	2 pulse / KZT 100	GPT Mode							OFF	ON
	5 pulse / KZT 100	ICT104U Mode							ON	OFF
	20 pulse / KZT 100	ICT104V Mode							ON	ON

This dip switch is located on the CPU board, remove the CPU board cover first.

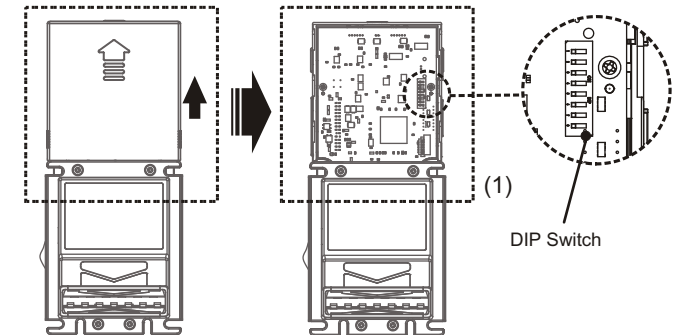

★ Manufacture setting

After setting dip switch of the credit pulses, you should reset the bill acceptor again.

Note : 1. Please reset the bill acceptor after set the dip switch.

2. Dip switches 1 to 5 are only used for pulse protocol.

3. Calibrate card.