


XBA-DOP6 Option Switch Settings

Supported bill DOP 20, 50, 100, 200, 500, 1000 6bills.

	FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
★	Reject DOP 20 & 50	ON							
★	Accept DOP 20 & 50	OFF							
★	Reject DOP 100		ON						
★	Accept DOP 100		OFF						
★	Reject DOP 200			ON					
★	Accept DOP 200			OFF					
★	Reject DOP 500				ON				
★	Accept DOP 500				OFF				
★	Reject DOP 1000					ON			
★	Accept DOP 1000					OFF			
★	Disable Bill Reject 4 Times BA Stop By 30 Sec						ON		
★	Enable Bill Reject 4 Times BA Stop By 30 Sec						OFF		
★	Stack Banknote when Power-up							ON	
★	Reject Banknote when Power-up							OFF	
★	Reserved								ON
★	Reserved								OFF

This dip switch is located at the side of XBA.

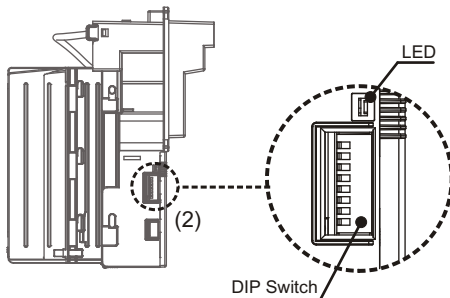


Currency Assign Data

Interface Bill value	ICT104U	ICT104V	Pulse	MDB
BV1	DOP 20	DOP 20	DOP 20	DOP 20
BV2	DOP 50	DOP 50	DOP 50	DOP 50
BV3	DOP 100	DOP 100	DOP 100	DOP 100
BV4	DOP 200	DOP 200	DOP 200	DOP 200
BV5	DOP 500	DOP 500	DOP 500	DOP 500
BV6	DOP 1000	DOP 1000	DOP 1000	DOP 1000

XBA-DOP6 (Pulse/MDB/ICT104U/ICT104V)

	FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
★	Inhibit Active HIGH	ON							
	Inhibit Active LOW	OFF							
★	Reserved		ON						
	Reserved		OFF						
★	Reserved			ON					
	Reserved			OFF					
★	Reserved				ON				
	Reserved				OFF				
★	Pulse Mode	MDB Mode			ICT104V Mode				
	Credit-Pulse Normal HIGH	Scaling Factor (SF) = 100 Decimal Point Position (DPP) = 2			Connect with coin changer	ON			
	Credit-Pulse Normal LOW	Scaling Factor (SF) = 1 Decimal Point Position (DPP) = 0			Connect with ICT VCCS converter board	OFF			
★	Pulse Mode						ON		
	Other Mode						OFF		
★	Pulse Mode	Other Mode							
	1 pulse / DOP 10	MDB Mode						OFF	OFF
	2 pulses / DOP 10	Reserved						OFF	ON
	4 pulses / DOP 10	ICT104U Mode						ON	OFF
	20 pulses / DOP 10	ICT104V Mode						ON	ON

This dip switch is located on the CPU board, remove the CPU board cover first.

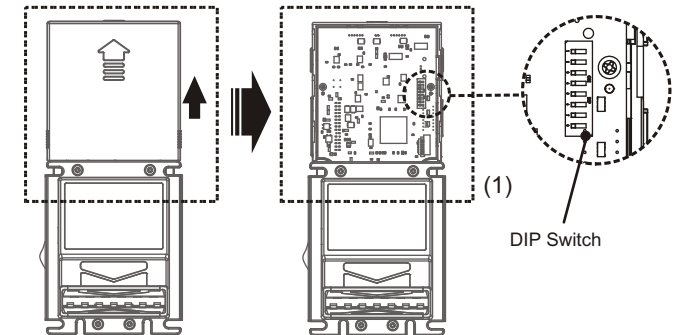

★ Manufacture setting

After setting dip switch of the credit pulses, you should reset the bill acceptor again.

Note : 1. Calibration card is needed.

2. No sleep function.