


XBA-GEL6 Option Switch Settings

Supported bill Lari 5, 10, 20, 50, 100, 200 6bills.

	FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
★	Reject Lari 5 & 10	ON							
★	Accept Lari 5 & 10	OFF							
	Reject Lari 20		ON						
★	Accept Lari 20		OFF						
	Reject Lari 50			ON					
★	Accept Lari 50			OFF					
	Reject Lari 100				ON				
★	Accept Lari 100				OFF				
	Reject Lari 200					ON			
★	Accept Lari 200					OFF			
	Disable Bill Reject 4 Times BA Stop By 30 Sec						ON		
★	Enable Bill Reject 4 Times BA Stop By 30 Sec						OFF		
	Stack Banknote when Power-up							ON	
★	Reject Banknote when Power-up							OFF	
	Reserved								ON
★	Reserved								OFF

This dip switch is located at the side of XBA.

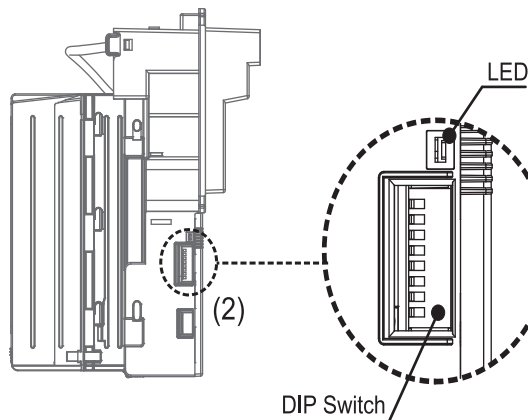

Currency Assign Data

Interface Bill value	ccNet	RS232 A0	Pulse	MDB	ICT104U
BV1	Lari 5	Lari 5	Lari 5	Lari 5	Lari 5
BV2	Lari 10	Lari 10	Lari 10	Lari 10	Lari 10
BV3	Lari 20	Lari 20	Lari 20	Lari 20	Lari 20
BV4	Lari 50	Lari 50	Lari 50	Lari 50	Lari 50
BV5	Lari 100	Lari 100	Lari 100	Lari 100	Lari 100
BV6	Lari 200	Lari 200	Lari 200	Lari 200	Lari 200

RS232 A0 INFORMATION

Code	Denomination
1	Reserved
2	Reserved
3	Lari 5
4	Lari 10
5	Lari 20
6	Lari 50
7	Lari 100
8	Lari 200
9	Reserved


Appendix

XBA-GEL6 (Pulse/MDB/RS232 A0/ccNet/ICT104U)

FUNCTION		SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
★	Inhibit Active HIGH	ON							
	Inhibit Active LOW	OFF							
★	Reserved								
	Reserved		OFF						
★	Reserved			ON					
	Reserved			OFF					
★	Reserved				ON				
	Reserved				OFF				
★	Pulse Mode	MDB Mode		ccNet Mode					
	Credit-Pulse Normal HIGH	SCALING_FACTOR 100 DECIMAL_PLACE_OFF 2		9600 Baud Rate			ON		
★	Credit-Pulse Normal LOW	SCALING_FACTOR 1 DECIMAL_PLACE_OFF 0		19200 Baud Rate			OFF		
	Pulse Mode						ON		
★	Other Mode						OFF		
	1 pulse / Lari 5	MDB Mode						OFF	OFF
★	2 pulses / Lari 5	RS232 A0 Mode						OFF	ON
	5 pulses / Lari 5	ccNet Mode						ON	OFF
	20 pulses / Lari 5	ICT104U Mode						ON	ON

★ Manufacture setting

This dip switch is located on the CPU board, remove the CPU board cover first.

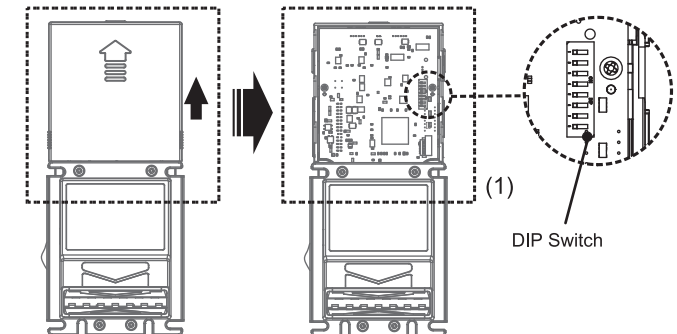

**After setting dip switch of the credit pulses, you should reset the bill acceptor again.

Note : 1.No sleep function.
2.Calibration card is needed.