


XBA-PLN8 Option Switch Settings

Supported bill PLN 10, 20, 50, 100, 200 5bills.
€ 5, 10, 20, 3bills.

	FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
	Reject PLN 10 & 20	ON							
★	Accept PLN 10 & 20	OFF							
	Reject PLN 50 & 100		ON						
★	Accept PLN 50 & 100		OFF						
	Reject PLN 200			ON					
★	Accept PLN 200			OFF					
	Reject € 5 & 10				ON				
★	Accept € 5 & 10				OFF				
	Reject € 20				ON				
★	Accept € 20				OFF				
	Disable Bill Reject 4 Times BA Stop By 30 Sec					ON			
★	Enable Bill Reject 4 Times BA Stop By 30 Sec					OFF			
	Stack Banknote when Power-up							ON	
★	Reject Banknote when Power-up							OFF	
	Enable IrDA Download								ON
★	Reserved								OFF

This dip switch is located at the side of XBA.

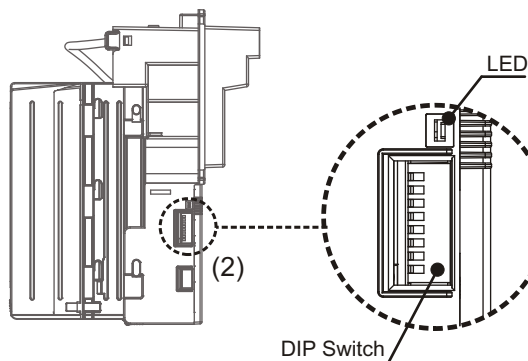


Currency Assign Data

Interface Bill value	ICT104U	GPT	ICT104V	Pulse	MDB
BV1	PLN 10	PLN 10	PLN 10	PLN 10	PLN 10
BV2	PLN 20	PLN 20	PLN 20	PLN 20	PLN 20
BV3	PLN 50	PLN 50	PLN 50	PLN 50	PLN 50
BV4	PLN 100	PLN 100	PLN 100	PLN 100	PLN 100
BV5	PLN 200		PLN 200	PLN 200	PLN 200
BV6	€ 5		€ 5	€ 5	€ 5
BV7	€ 10		€ 10	€ 10	€ 10
BV8	€ 20		€ 20	€ 20	€ 20

XBA-PLN8 (Pulse/MDB/ICT104U/GPT/ICT104V)

	FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
	Inhibit Active HIGH	ON							
★	Inhibit Active LOW	OFF							
	Reserved	ON							
★	Reserved	OFF							
	Reserved		ON						
★	Reserved		OFF						
	Reserved				ON				
★	Reserved				OFF				
	Pulse Mode	MDB Mode			ICT104V Mode				
★	Credit-Pulse Normal HIGH	Scaling Factor (SF)= 100 Decimal Point Position (DPP)= 2			Connect with coin changer		ON		
	Credit-Pulse Normal LOW	Scaling Factor (SF)= 1 Decimal Point Position (DPP)= 0			Connect with ICT VCCS converter board		OFF		
★	Pulse Mode						ON		
	Other Mode						OFF		
	Pulse Mode	Other Mode							
★	1 pulse / PLN 10	MDB Mode						OFF	OFF
	5 pulses / PLN 10	GPT Mode						OFF	ON
	10 pulses / PLN 10	ICT104U Mode						ON	OFF
	25 pulses / PLN 10	ICT104V Mode						ON	ON

This dip switch is located on the CPU board, remove the CPU board cover first.

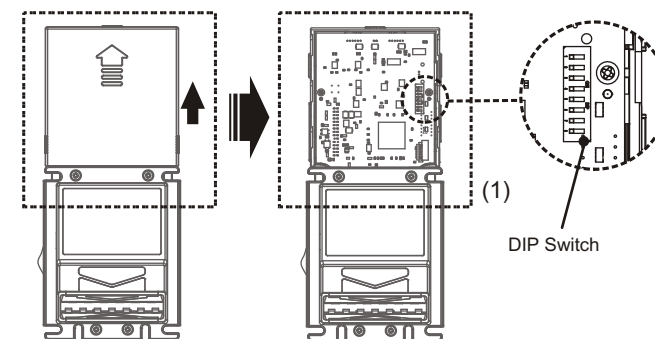

★ Manufacture setting

After setting dip switch of the credit pulses, you should reset the bill acceptor again.

Note : 1. Please reset the bill acceptor after set the dip switch.

2. Dip switches 1 to 5 are only used for pulse protocol.

3. Calibrate card.

4. The transaction Record can be saved by USB MSD (only for EX series).