


XBA-CLP4 Option Switch Settings

Supported bill Ch\$ 1000, 2000, 5000, 10000 4bills.

	FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
★	Reject Ch\$ 1000	ON							
★	Accept Ch\$ 1000	OFF							
★	Reject Ch\$ 2000		ON						
★	Accept Ch\$ 2000		OFF						
★	Reject Ch\$ 5000			ON					
★	Accept Ch\$ 5000			OFF					
★	Reject Ch\$ 10000				ON				
★	Accept Ch\$ 10000				OFF				
★	Reserved				ON				
★	Reserved				OFF				
★	Disable Bill Reject 4 Times BA Stop By 30 Sec					ON			
★	Enable Bill Reject 4 Times BA Stop By 30 Sec					OFF			
★	Stack Banknote when Power-up						ON		
★	Reject Banknote when Power-up						OFF		
★	Reserved							ON	
★	Reserved							OFF	

This dip switch is located at the side of XBA.

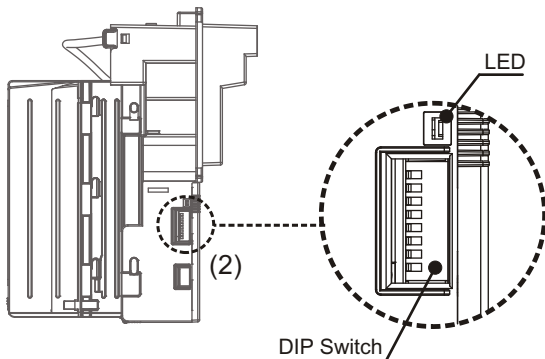


Currency Assign Data

Interface Bill value	ICT104U	GPT	ICT104V	Pulse	MDB
BV1	1000	1000	1000	1000	1000
BV2	2000	2000	2000	2000	2000
BV3	5000	5000	5000	5000	5000
BV4	10000	10000	10000	10000	10000

XBA-CLP4 (Pulse/MDB/ICT104U/GPT/ICT104V)

	FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
★	Inhibit Active HIGH	ON							
	Inhibit Active LOW	OFF							
★	Reserved		ON						
	Reserved		OFF						
★	Reserved			ON					
	Reserved			OFF					
★	Reserved				ON				
	Reserved				OFF				
	Pulse Mode	MDB Mode			ICT104V Mode				
★	Credit-Pulse Normal HIGH	Scaling_Factor (SF)=1 Decimal Point Position (DPP)=0			Connect with coin changer	ON			
	Credit-Pulse Normal LOW	Scaling_Factor (SF)=10 Decimal Point Position (DPP)=1			Connect with ICT VCCS converter board	OFF			
★	Pulse Mode						ON		
	Other Mode						OFF		
	Pulse Mode	Other Mode							
★	1 pulse / Ch\$1000	MDB Mode						OFF	OFF
	2 pulse / Ch\$1000	GPT Mode						OFF	ON
	4 pulse / Ch\$1000	ICT104U Mode						ON	OFF
	20 pulse / Ch\$1000	ICT104V Mode						ON	ON

This dip switch is located on the CPU board, remove the CPU board cover first.

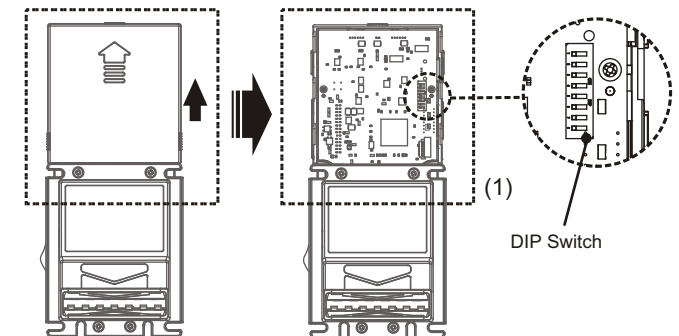

★ Manufacture setting

Note : 1.After setting dip switch of the credit pulses,you should reset the bill acceptor again.
2.Calibrate card.